


## Magnetic Dipstick

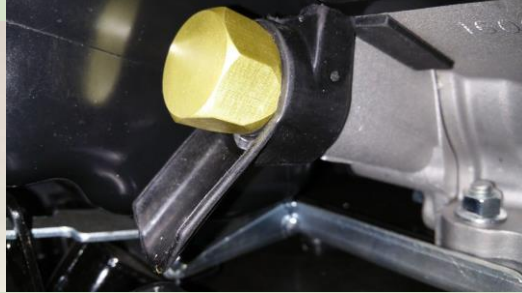

NOTE: Allow components to cool after running generator before touching.

Clean-up. A wipe down with isopropyl alcohol will make quick work of the job. Isopropyl alcohol can be used on the dipstick without adverse effects to the finish or O-ring.

See us at: <https://genexhaust.com/>